


Gapped SMD beads for power inductors

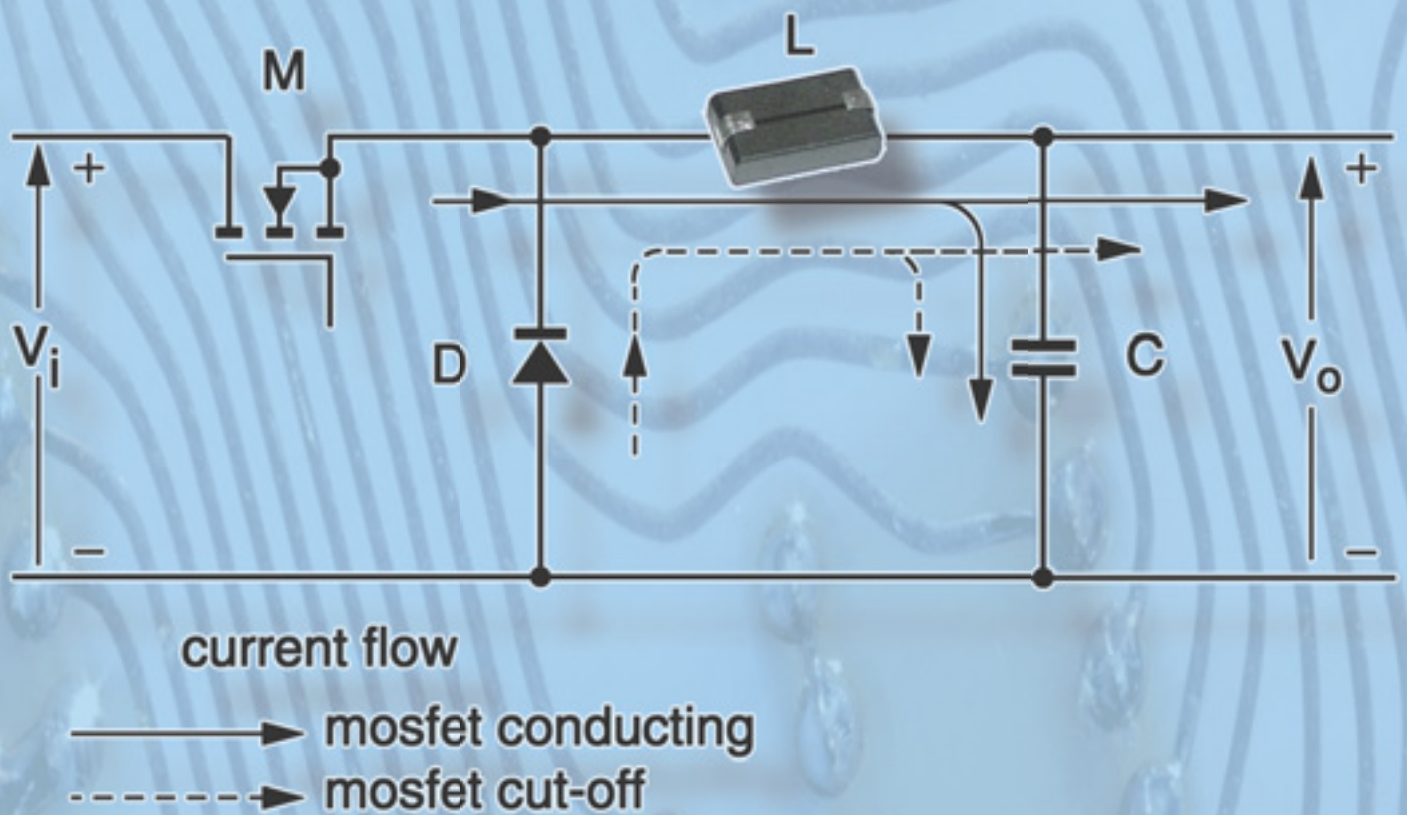

Gapped SMD beads for power inductors

Introduction


Traditional power supply architectures for PC's are facing problems with the latest generation of integrated circuits. Lower voltages and higher currents lead to increasing losses in supply lines and sensitivity to interference. On top of this, fast microprocessors introduce high frequency transients which are difficult to regulate with a voltage regulator module (VRM) from a distant main supply.

The fundamental solution utilizes an intermediate voltage and distributed point of load (POL) converters. These are small dc/dc converters, placed close to the load on the PCB. FERROXCUBE now introduces gapped SMD beads, perfectly suitable for the POL concept. They are small inductors typically meant to serve as output inductor in buck / boost stages and

feature the state of the art power material 3C96. Depending on relative ripple current, switching frequencies up to 1 MHz are possible to realize compact geometries. Saturation rated current goes up to 20 A and the dc resistance is less than 1 mΩ. These gapped beads are available in 2 sizes (1812 and 3512), packed in tape on reel and they are SMD mountable. Furthermore, they are lead-free and fully comply with the RoHS regulations on hazardous substances.

Features

- Very suitable for POL converter concept.
- High switching frequency, up to 1 MHz.
- High current rating, up to 20 A.
- Low dc resistance, less than 1 mΩ.
- Small size (1812 and 3512).
- SMD mountable.
- Lead-free / RoHS-compliant.

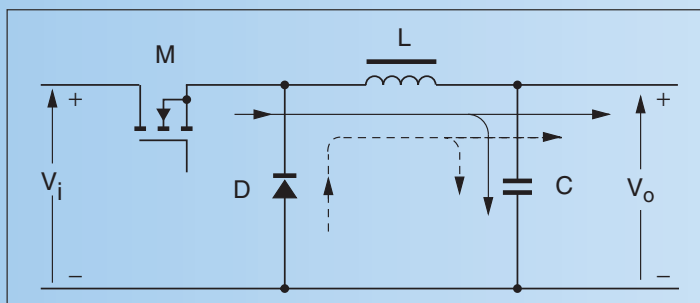

Buck or down converter

current flow
 mosfet conducting
 mosfet cut-off

Technical capabilities

General data

ITEM	SPECIFICATION
strip material	copper (Cu), tin (Sn) plated see website for lead-free info 
Solderability	IEC 60068-2-58, part 2, test Ta, method I
Taping method	IEC 60286-3, EIA 481-I and EIA 481-2




Parameters and type numbers

GRADE	L at 1 MHz (nH)	I _{max} ⁽¹⁾ (A)	TYPE NUMBER
3C96	BDS 3/3/4.6 ; mass ≈ 0.15 g ⁽²⁾		
	50 ± 20 %	20	BDS3/3/4.6-3C96-A50
	75 ± 20 %	15	BDS3/3/4.6-3C96-A75
3C96	BDS 4.6/3/8.9 ; mass ≈ 0.5 g ⁽³⁾		
	100 ± 20 %	20	BDS4.6/3/8.9-3C96-A100
	150 ± 20 %	20	BDS4.6/3/8.9-3C96-A150


Note

1. I_{max} is the saturation rated current.
2. DC resistance < 0.6 mΩ.
3. DC resistance < 1.0 mΩ.

SMD bead BDS3/3/4.6

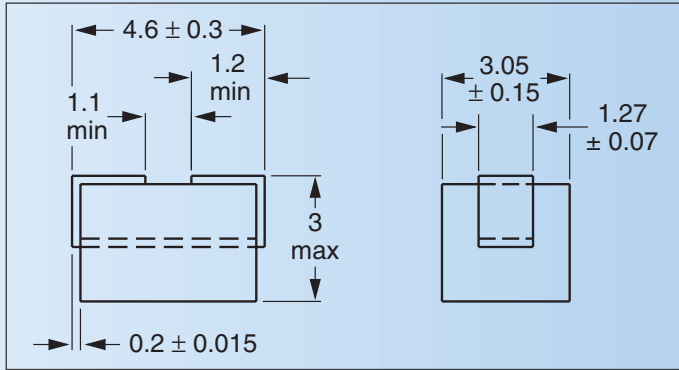

SMD bead BDS4.6/3/8.9

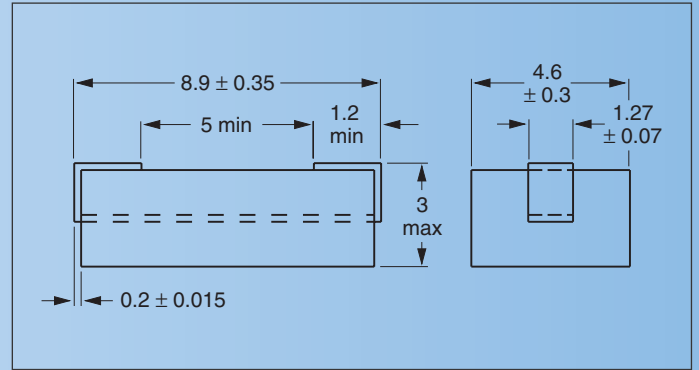


Advantages of the material 3C96 for power inductors

3C96 - Material Characteristics

	CONDITIONS	VALUE	UNIT
μ_i	25 °C, ≤ 10 kHz, 0.25 mT	$2000 \pm 20 \%$	
μ_a	100 °C, 25 kHz, 200 mT	≈ 5500	
B	25 °C, 10 kHz, 1200 A/m 100 °C, 10 kHz, 1200 A/m	≈ 500 ≈ 440	mT
P_v	100 °C, 100 kHz, 100 mT 100 °C, 100 kHz, 200 mT 100 °C, 500 kHz, 50 mT	≈ 40 ≈ 300 ≈ 250	kW/m ³
ρ	DC, 25 °C	≈ 5	Ω m
T_c		≥ 240	°C
density		≈ 4800	kg/m ³

Our lowest loss general power material 3C96 is an excellent choice to use in high-frequency output inductors. With a small ripple only, it can work at much higher switching frequency then it would as a transformer material, preserving its higher saturation over real high-frequency transformer materials. The main characteristics are given in the table, but for complete graphical information, see our handbook or look on the website.

Saturation curves

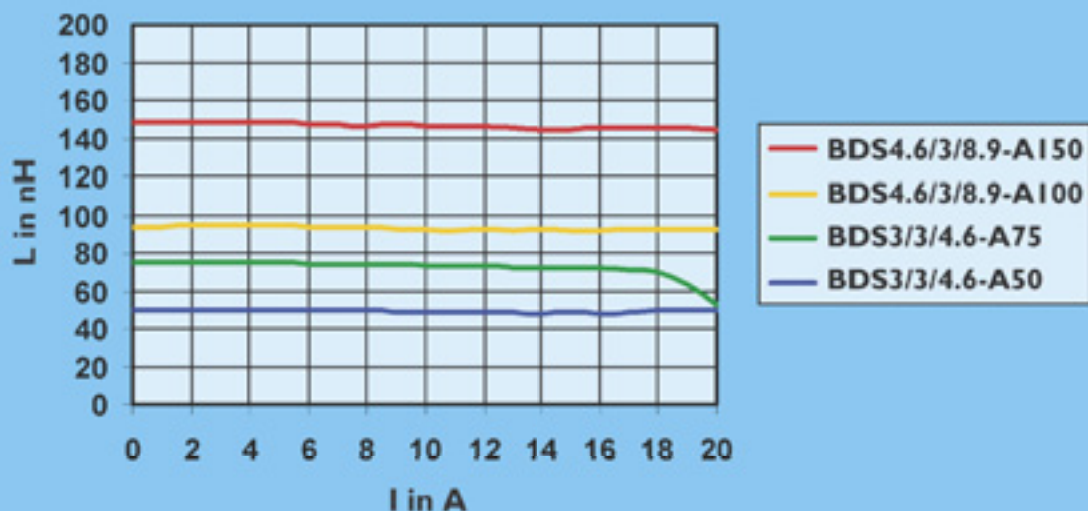

FERROXCUBE - your global partner

Australia: Contact Ferroxcube Taiwan

Tel. +886 2 86650099, Fax: +886 2 86650145

Austria: Contact Ferroxcube Germany

Tel: +49 (040) 527 28 305, Fax: +49 (040) 527 28 306

Benelux: Ferroxcube Netherlands, EINDHOVEN

Tel: +31 (0)40 27 24 216, Fax: +31 (0)40 27 24 411

Canada: Contact Ferroxcube USA

Tel: +1 915 599 2513/2328, Fax: +1 915 599 2555

China: Ferroxcube Hong Kong

Tel: +852 2319 2740, Fax: +852 2319 2757

Ferroxcube South of China

Tel: +86 769 7382420, Fax: +86 769 7339561

Ferroxcube Suzhou

Tel: +86 512 68095048, Fax: +86 512 68097128

Czech Republic: Contact Ferroxcube Poland

Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

Denmark: Contact Ferroxcube Sweden

Tel: +46 8 580 119 76, Fax: +46 8 580 121 60

Finland: Contact Ferroxcube Sweden

Tel: +46 8 580 119 76, Fax: +46 8 580 121 60

France: Ferroxcube France, NANTERRE

Tel: +33 (01) 5551 8422, Fax: +33 (01) 5551 8423

Germany: Ferroxcube Germany, HAMBURG

Tel: +49 (040) 527 28 302, Fax: +49 (040) 527 28 306

Greece: Contact Ferroxcube Italy

Tel: +39 02 241131 1, Fax: +39 02 241131 11

Hungary: Contact Ferroxcube Poland

Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

Indonesia: Contact Ferroxcube Singapore

Tel: +65 6244 7815, Fax: +65 6449 0446

Ireland: Contact Ferroxcube UK

Tel: +44 870 2418759, Fax: +44 870 2418761

Israel: Arrow\Rapac Ltd., PETACH TIKVA

Tel: +972 3 9203480, Fax: +972 3 9203443

Italy: Ferroxcube Italy, SESTO S. GIOVANNI (MI)

Tel: +39 02 241131 1, Fax: +39 02 241131 11

Korea: FC Tech Co., Ltd., SEOUL

Tel: +82 2 6352 4422, Fax: +82 2 6352 4420

Malaysia: Contact Ferroxcube Singapore

Tel: +65 6244 7815, Fax: +65 6449 0446

Mexico: Contact Ferroxcube USA

Tel: +1 915 599 2513/2328, Fax: +1 915 599 2555

New Zealand: Contact Ferroxcube Taiwan

Tel. +886 2 86650099, Fax: +886 2 86650145

Norway: Contact Ferroxcube Sweden**Philippines:** Contact Ferroxcube Singapore

Tel: +65 6244 7815, Fax: +65 6449 0446

Poland: Ferroxcube Polska, SKIERNIEWICE

Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

Portugal: Contact Hispano Ferritas, Spain

Tel: +34 (949) 247 153, Fax: +34 (949) 247 146

Singapore: Ferroxcube Singapore, SINGAPORE

Tel: +65 6244 7815, Fax: +65 6449 0446

Slovak Republic: Contact Ferroxcube Poland

Tel: +48 46 834 00 07, Fax: +48 46 834 00 35

Spain: Hispano Ferritas, GUADALAJARA

Tel: +34 (949) 247 153, Fax: +34 (949) 247 146

Sweden: Ferroxcube Sweden, JÄRFÄLLA

Tel: +46 8 580 119 76, Fax: +46 8 580 121 60

Switzerland: Contact Ferroxcube Germany

Tel: +49 (040) 527 28 305, Fax: +49 (040) 527 28 306

Taiwan: Ferroxcube Taiwan, TAIPEI

Tel. +886 2 86650099, Fax: +886 2 86650145

Turkey: Contact Ferroxcube Italy

Tel: +39 02 241131 1, Fax: +39 02 241131 11

United Kingdom: Ferroxcube UK, LEATHERHEAD

Tel: +44 870 2418759, Fax: +44 870 2418761

United States: Ferroxcube USA, EL PASO (TX)

Tel: +1 915 599 2513/2328, Fax: +1 915 599 2555

For all other countries apply to closest regional sales office:**■ HAMBURG, Germany**

Tel: +49 (040) 527 28 302, Fax: +49 (040) 527 28 306

e-mail: saleseurope@ferroxcube.com

■ EL PASO (TX), USA

Tel: +1 915 599 2513/2328, Fax: +1 915 599 2555

e-mail: salesusa@ferroxcube.com

■ TAIPEI, Taiwan

Tel. +886 2 86650099, Fax: +886 2 86650145

e-mail: salesasia@ferroxcube.com

© Ferroxcube International Holding B.V. 2005

All rights are reserved. Reproduction in whole or in part is prohibited without the prior written consent of the copyright owner.

The information presented in this document does not form part of any quotation or contract, is believed to be accurate and reliable and may be changed without notice. No liability will be accepted by the publisher for any consequence of its use. Publication thereof does not convey nor imply any license under patent- or other industrial or intellectual property rights.

Visit our web-site for the latest information on new products, application info as well as updated phone- and fax numbers

Internet: www.ferroxcube.com

Printed in The Netherlands

9398 288 01811

Date of release: 06/05